APPROVED FOR PUBLIC RELEASE DISTRIBUTION UNLIMITED

ASE AFPEA REPORT NO. 95-R-02 AFPEA PROJECT NO. 93-P-101

ROBERT S. TEKESKY

Mechanical Engineer

DSN 787-3362 Comm. (513) 257-3362



Development of the Nose Radome Container for Combat Talon II CNU 469/E

AFMC LSO/LOP
AIR FORCE PACKAGING TECHNOLOGY AND ENGINEERING FACILITY
WRIGHT PATTERSON AFB, OH 45433-5540
MAY 1995

19950630 183

DTIC QUALITY INSPECTED 5

NOTICE

When government drawings, specifications, or other data are used for any purpose other than in connection with a definitely related government procurement operation, the United States Government thereby incurs no responsibility whatsoever, and the fact that the government may have formulated, furnished, or in any way supplied the said drawings, specifications, or other data, is not to be regarded by implication or otherwise as in any manner licensing the holder or any other person or corporation or conveying any rights or permission to manufacture use or sell any patented invention that may in any way be related thereto. This report is not to be used in whole or part for advertising or sales purposes.

PROJECT:

93-P-101

REPORT NO:

95-R-02

TITLE: Development of the Nose Radome Container

for Combat Talon II CNU 469/E

ABSTRACT

The Air Force Packaging Technology and Engineering Facility (AFPTEF) provided engineering support to the Combat Talon II (CTII) program. CTII is a modified C-130 aircraft designed for special operations. Through 1993 and 1994 calendar years, AFPTEF supported the CTII program by developing an overseas shipping and storage container for the nose radome. The shipping container provided by the prime contractor of the nose radome processed several handling problems. The container, an oversized wooden container, only allowed the nose radome to be shipped by surface vehicles, ships, or C-5 aircraft. The CTII required access to remote operation locations not accessible by any of these modes of transportation. Removal of the nose radome from the container required eight personnel and a minimum of four hours. Lag bolts used for securing the container to the floor at times had to be cut to open the container. The nose radome, mounted in a vertical position, had to be rotated into a horizontal position to be placed on the C-130 aircraft. In order to accomplish this task, the nose radome had to be physically rotated onto a mattress that protected the nose radome from being scratched. Then the nose radome was transferred to a handling pallet by hand. The handling pallet held the nose radome while the damaged nose radome was removed from the aircraft and placed on another handling pallet. The damaged nose radome was placed back into the container in a similar fashion.

The AFPTEF container developed is a pressure treated lumber design with an aluminum structural frame to support the nose radome, in a horizontal position, during shipping and storage. The container also houses two aluminum pallets for handling the nose radome. One pallet is used for removing the nose radome from the container and the other is used for handling the damaged nose radome and placing it back in the container. The damaged nose radome can then be shipped for repairs. With the new container, the installation procedure from start to finish requires four personnel or less and takes only two hours. This new container has enable the Air Force to reduce cost in personnel, transportation, and time while increasing productivity and readiness.

MAN-HOURS: 2387 Hrs

PREPARED BY:

PUBLICATION DATE:

ROBERT S. TEKESKY Mechanical Engineer

AF Packaging Technology

& Engineering Facility

3 0 MAY 1995

REVIEWED BY:

TED HINDS

Supervisor, Design Group

AF Packaging Technology

& Engineering Facility

APPROVED BY

LESLIE K. CLARKE, III

Chief, AF Packaging Technology & Engineering

Facility

TABLE OF CONTENTS

	<u>P.</u>	<u>AGE</u>
Abstract	ents	. i
Table of Con	ents	11
Introduction		. 1
Backgro	ınd	. 1
Description	of Container	1
Descripcion	· · · · · · · · · · · · · · · · · · ·	1
Design.		1
Constru	tion	• +
Conclusion		. 2
	APPENDICES	
		_
Appendix 1:	Photographs	. 3
Appendix 2:	Distribution List	10
Appendix 3:	Report Documentation	16
Whheriary 1.	report becamerate to the transfer of the trans	

			2
Accesion	For		
NTIS (DTIC T Unanno Justifica	TAB unced	X	
By			
Availability Codes			
Dist	Avail and or Special		
A-1			

INTRODUCTION

BACKGROUND: Aeronautical System Division (ASC/LUML), Wright-Patterson AFB OH 45433-5000 requested assistance from the Air Force Packaging Technology and Engineering Facility (AFPTEF) to design a shipping and storage container for the Combat Talon II (CTII), a modified C-130 Aircraft, Nose Radome. The \$500,000 nose radome and associated handling equipment is required to be shipped in the cargo compartment of a C-130 aircraft, see Figure 1. The nose radome measures 76 inches high, 75 inches wide and 87 inches deep. A handling pallet is used to raise the nose radome up into place. All the items are required to replace a damage nose radome on the C-130 aircraft.

The shipping container provided by the prime contractor of the nose radome processed several handling problems. The container, an oversized wooden container, see Figure 2, only allowed the nose radome to be shipped by surface vehicles, ships, or C-5 aircraft. The CTII required access to remote operation locations not accessible by any of these modes of transportation. Removal of the nose radome from the container required eight personnel and a minimum of four hours. Lag bolts used for securing the container to the floor at times had to be cut to open the container. The nose radome, mounted in a vertical position, see Figure 3, had to be rotated into a horizontal position to be placed on the C-130 aircraft. In order to accomplish this task, the nose radome had to be physically rotated onto a mattress that protected the nose radome from being scratched, see Figure 4. the nose radome was transferred to a handling pallet by hand, see Figures 5 & 6. The handling pallet held the nose radome while the damaged nose radome was removed from the aircraft and placed on another handling pallet. The damaged nose radome was placed back into the container in a similar fashion.

DESCRIPTION OF CONTAINER

<u>DESIGN</u>: The AFPTEF was able to develop a new shipping and storage container that allowed transportation aboard smaller, more economical aircraft such as a C-130 or C-141. The AFPTEF also enhanced the handling of the container and decreased the time required to load and unload the nose radome. The AFPTEF design allowed the use of existing support equipment for handling the container.

CONSTRUCTION: The AFPTEF designed a wooden container made of copper chromate pressure treated wood with an aluminum mounting frame and two, aluminum handling pallets housed inside the container, see Figure 7. The container design is a modified version of MIL-C-104 container. The container walls are held in place by metal clips that can be removed with a common screwdriver and can be removed in less than twenty minutes.

The nose radome is mounted on the frame the same as it would be mounted on the aircraft and suspended above the floor of the container, see Figure 8. This eliminates any possibility of the nose radome being damaged by contact between the container and

itself while being shipped. Two handling pallets are housed inside the container under the radome in a specialized "E Channel" extrusion for loading and unloading of the nose radome, see Figure 9.

One handling pallet is positioned under the nose radome to support and remove the nose radome from the container, see Figure 10, while the other is used for the removal of the damaged nose radome from the aircraft and placement back into the container. The new radome can be lifted up to and mounted the aircraft, see figure 11. The horizontal mounting position of the nose radome and the handling pallets eliminated the problems of physically rotating and possible damage to the nose radome, injury to personnel handling the nose radome, and where to place and the possible further damaging of the damaged nose radome while the new nose radome was being mounted to the aircraft.

CONCLUSION

With the new container, the installation procedure from start to finish requires four personnel or less and takes only two hours. This new container has enable the Air Force to reduce cost in personnel, transportation, and time while increasing productivity and readiness. It also eliminates the dangerous position which personnel were exposed too, that in itself is an intangible benefit.

APPENDIX 1

PHOTOGRAPHS

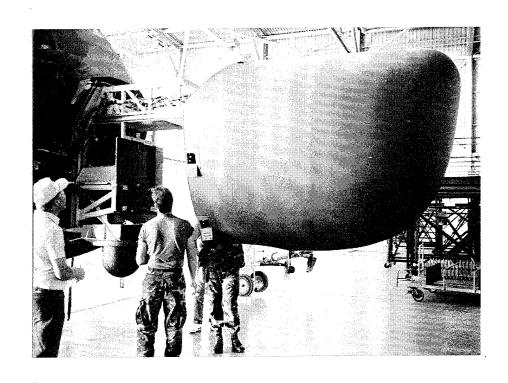


Figure 1. NOSE RADOME.

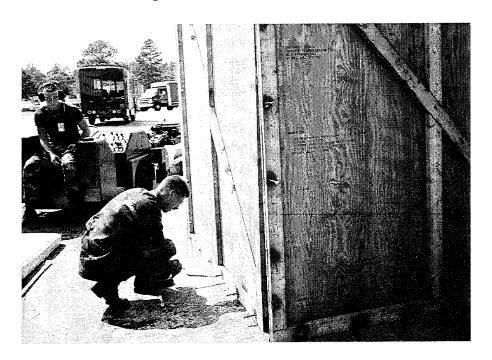


Figure 2. PRIME CONTRACTOR'S CONTAINER.

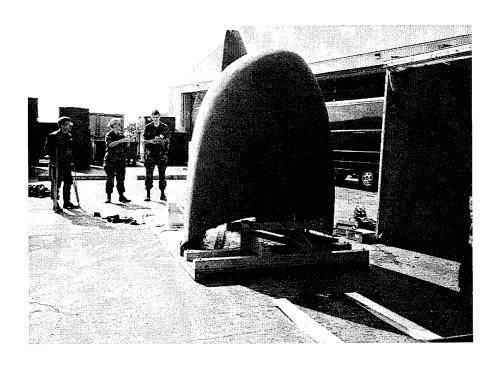


Figure 3. NOSE RADOME MOUNTED VERTICALLY.



Figure 4. MATTERESS USED TO PROTECT NOSE RADOME WHEN ROTATING.

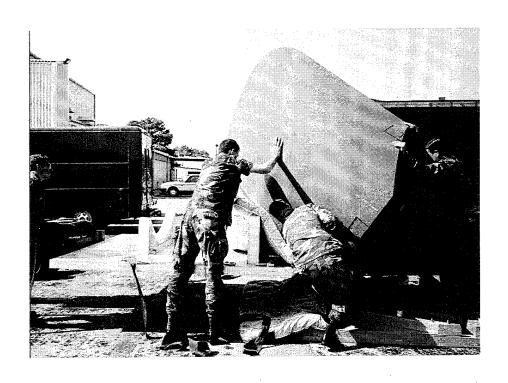


Figure 5. TRANSFER OF NOSE RADOME TO HANDLING PALLET.



Figure 6. TRANSFER OF NOSE RADOME TO HANDLING PALLET.

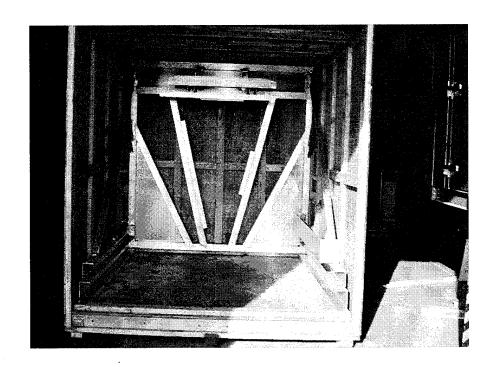


Figure 7. AFPTER WOOD CONTAINER WITH SUPPORT FRAME.

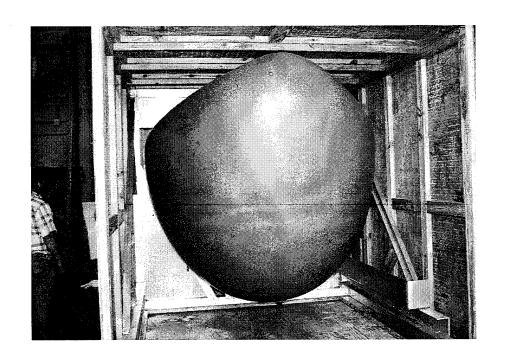


Figure 8. NOSE RADOME MOUNTED INSIDE CONTAINER.

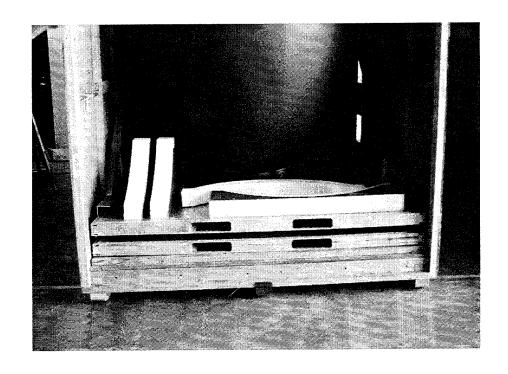


Figure 9. HANDLING PALLETS STORED INSIDE CONTAINER.

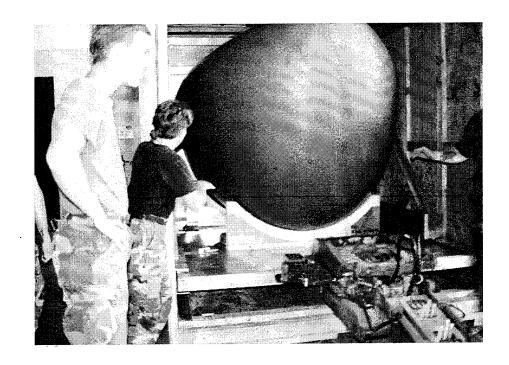


Figure 10. REMOVAL OF NOSE RADOME FROM CONTAINER.

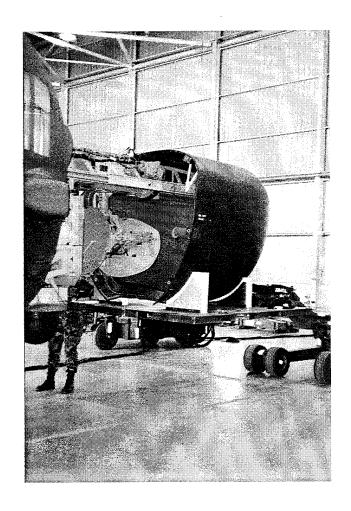


Figure 11. NOSE RADOME IN POSITION TO BE MOUNTED TO AIRCRAFT.

APPENDIX 2 DISTRIBUTION LIST

DISTRIBUTION LIST

DTIC/FDAC CAMERON STATION ALEXANDRIA VA 22304-6145	1
HQ AFMC/LG WRIGHT-PATTERSON AFB OH 45433-5006	1
HQ AFMC/LGT WRIGHT-PATTERSON AFB OH 45433-5006	1
AFMC LSO/LO WRIGHT-PATTERSON AFB OH 45433	1
AFMC LSO/LOP (LIBRARY) WRIGHT-PATTERSON AFB OH 45433-5540	10
HQ USAF/LGTT 1030 PENTAGON RM 4B322 WASHINGTON DC 20330-1030	1
72 ABW/LGT 7615 SENTRY BLVD SUITE 201 TINKER AFB OK 73145-8912	1
72 ABW/LGTP 7615 SENTRY BLVD SUITE 201 TINKER AFB OK 73145-8912	1
75 ABW/LGT BLDG 900 7520 WARDLEIGH RD HILL AFB 84056-5733	1
75 ABW/LGTP 7530 11th ST HILL AFB UT 84056-5707	1
76 LG/LGT BLDG 1530 410 NORTH LUKE RD STE 289 KELLY AFB TX 78241-5312	1
76 LG/LGTP 401 WILSON BLVD KELLY AFB TX 78241-5340	1
77 ABW/LGT 1961 IDZOREK ST MCCLELLAN AFB CA 95652-1620	1
77 ABW/LGTP 1961 IDZOREK ST	1

78 ABW/LGT BLDG 376	1
455 BYRON ST SUITE 1150 ROBINS AFB GA 31098-1860	_
78 ABW/LGTP BLDG 376 455 BYRON ST SUITE 1150 ROBINS AFB GA 31098-1860	1
ASC/AWL WRIGHT-PATTERSON AFB OH 45433	1
ASC/ALXS WRIGHT-PATTERSON AFB OH 45433-7642	1
ASC/VXTC BLDG 614 102 WEST D AVE SUITE 168 EGLIN AFB FL 32542-5313	1
GSA OFFICE OF ENGINEERING MGT PACKAGING DIVISION WASHINGTON DC 20406	1
COMMANDER ATTN: N KARL (SUP 045) NAVAL SUPPLY SYSTEMS COMMAND WASHINGTON DC 20376-5000	1
COMMANDER ATTN: E PANIGOT (AIR 41212A) NAVAL AIR SYSTEMS COMMAND WASHINGTON DC 20361	1
COMMANDER ATTN: T CORBE (CODE 8218) SPACE AND NAVAL WARFARE SYSTEMS COMMAND WASHINGTON DC 20360	1
ATTN: C MANWARRING (FAC 0644) NAVAL FACILITIES ENGINEERING COMMAND HOFFMAN BLDG 2 ROOM 12S21 ALEXANDRIA VA 22332	1
COMMANDING OFFICER ATTN: K POLLOCK (CODE 15611K) NAVAL CONSTRUCTION BATTALION CENTER PORT HUENEME CA 93043	1
COMMANDER NAVAL SEA SYSTEMS COMMAND ATTN: G MUSTIN (SEA 66P) WASHINGTON DC 20362	1

COMMANDER ATTN: F BASFORD (SEA 05M3) NAVAL SEA SYSTEMS COMMAND WASHINGTON DC 20362	1
ATTN: E. H. BRIGGS (CODE 0512) NAVAL AVIATION SUPPLY COMMAND 700 ROBBINS AVENUE PHILADELPHIA PA 19111-5098	1
ATTN: F SECHRIST (CODE 0541) NAVY SHIPS PARTS CONTROL CENTER PO BOX 2020 MECHANICSBURG PA 17055-0788	1
COMMANDING OFFICER ATTN: F MAGNIFICO (SESD CODE 9321) NAVAL AIR ENGINEERING CENTER LAKEHURST NJ 08733-5100	1
COMMANDING OFFICER NAVAL WEAPONS STATION EARLE NWHC/CODE 8023 COLTS NECK NJ 07722-5000	1
US AMC PACKAGING STORAGE AND CONTAINERIZATION CENTER/SDSTO-TE-E 16 HAP ARNOLD BLVD TOBYHANNA PA 18466-5097	1
DLSIE/AMXMC-D US ARMY LOGISTICS MGT CTR FT LEE VA 23801-6034	1
ATTN: Mike Ivankoe US ARMY ARDEC/SMCAR-AEP DOVER NJ 07801-5001	1
US ARMY NATICK LABS/STRNC-ES NATICK MA 01760	1
AFMC LSO/LOE WRIGHT-PATTERSON AFB OH 45433	1
ASC/SDM WRIGHT-PATTERSON AFB OH 45433	1

ATTN: DLA-MMDO DEFENSE LOGISTICS AGENCY CAMERON STATION ALEXANDRIA VA 22304-6100	1
ATTN: DLA-AT DEFENSE CONTRACT MANAGEMENT COMMAND CAMERON STATION ALEXANDRIA VA 22304-6190	1
AGMC/LGT 813 IRVINGWICK DRIVE WEST NEWARK AFB OH 43057-0019	1
AMARC/LGT 6805 E. IRVINGTON RD DAVIS MONTHAN AFB AZ 85707-4341	1
2750 TRANS/DMTT WRIGHT-PATTERSON AFB OH 45433-5001	1
HQ PACAF/LGT BLDG 1102 25 E. ST. STE 1326 HICKAM AFB HI 96853-5426	1
HQ USAFE/LGT UNIT 3050 BOX 105 APO AE 09094-0105	1
HQ ACC/LGT 130 DOUGLAS ST STE 210 LANGLEY AFB VA 23665-2791	1
HQ AF SPACECOM/LGT 150 VANDENBURG ST., STE 1105 PETERSON AFB CO 80914-5000	1
HQ ANGRC/LGT 3500 FETCHET AVE ANDREWS AFB MD 20331-5157	1
HQ AETC/LGT 555 E ST EAST RANDOLPH AFB TX 78150-4440	1
AFISC/SEWV NORTON AFB CA 92409-7001	1

HQ SSG/LGT BLDG 856 201 EAST MORE DR, RM 133 MAB-GUNTER ANEX AL 36114-3005	1
HQ AMC/XON BLDG 1600 402 SCOTT DR RM 132 SCOTT AFB IL 62225-5363	1
SCHOOL OF MILITARY PACKAGING TECHNOLOGY ATSZ-MP ABERDEEN PROVING GROUND MD 21005-5001	1
COMMANDANT OF MARINE CORPS HQ USMC ATTN: CODE LPP-2 2 NAVY ANNEX WASHINGTON DC 20380-1775	1
ATTN: DGSC/QED DEFENSE GENERAL SUPPLY CENTER 8100 JEFFERSON DAVIS HIGHWAY RICHMOND VA 23297-5000	1
ATTN: DGSC/OMAD DEFENSE GENERAL SUPPLY CENTER 8100 JEFFERSON DAVIS HIGHWAY RICHMOND VA 23297-5000	1
ASC/LUML BLDG 16 WRIGHT-PATTERSON AFB OH 45433	2

APPENDIX 3 REPORT DOCUMENTATION

REPORT DOCUMENTATION PAGE

Form Approved
OMB No. 0704-0188

Public reporting burden for this collection of information is estimated to average 1 hour per response, including the time for reviewing instructions, searching existing data sources, gathering and maintaining the data needed, and completing and reviewing the collection of information. Send comments regarding this burden estimate or any other aspect of this collection of information, including suggestions for reducing this burden, to Washington Headquarters Services, Directorate for Information Operations and Reports, 1215 Jefferson Davis Highway, Suite 1204, Arlington, VA 22202-4302, and to the Office of Management and Budget, Paperwork Reduction Project (0704-0188), Washington, DC 20503.

Davis Highway, Suite 1204, Arington, VA 22202-4				
1. AGENCY USE ONLY (Leave blank)		3. REPORT TYPE AND		
	MAY 95	Final 06 Jap		
4. TITLE AND SUBTITLE Combat Talon II Nos	e Radome Containe	i i	5. FUNDI	NG NUMBERS
6. AUTHOR(S)				
Robert S. Tekesky		S. HOLLER TOWN		
7. PERFORMING ORGANIZATION NAM	ME(S) AND ADDRESS(ES)			RMING ORGANIZATION
Air Force Packaging	Technology		REPOR	RT NUMBER
and Engineering Fac	ility (AFPTEF)			
AFMC LSO/LOP			95-	-R-02
5215 Thurlow St. BL		27725		
Wright-Patterson AF 9. SPONSORING/MONITORING AGEN			10 SDON	SORING / MONITORING
9. SPONSOKING / MONTIORING AGEN	ICY NAME(S) AND ADDRESS(ES)	ACCHOLOPHOLOP BUTCH PER ACTO		CY REPORT NUMBER
11. SUPPLEMENTARY NOTES				
12a. DISTRIBUTION / AVAILABILITY ST	TATEMENT	239 ACM (17.00 ACM)	12b. DIST	TRIBUTION CODE
DISTRIBUTION UNLIMI	TED	EST TO STATE OF THE STATE OF TH		
		ALEXANDER OF THE PROPERTY OF T		
cost in personnel, tivity and readines	ging Technology a g support to the overseas shippin he AFPTEF contain inum structural f ition, during shi minum pallets for for removing the ed for handling t ainer. The damag the new container h requires four p w container has e transportation, a	Combat Talon of and storage er is a pressorame to support pping and storage handling the nose radome fine damaged nose damaged nose radome, the installation of least the landled the Air andled the Air and the storage and the storage radome.	II (C' conta ure tr rt the rage. nose rom th se rac e can ation ess ar	TII) program. ainer for reated lumber e nose radome, The container radome. he container dome and placing then be shipped procedure nd takes only ce to reduce easing produc-
14. SUBJECT TERMS		talente de la constantina della constantina dell	i	15. NUMBER OF PAGES
CNU 469/E, Wood Con	tainer, Reusable	Container,		17 16. PRICE CODE
Design, Container	SECURITY OF ACCIDION TO	19. SECURITY CLASSIFIC	CATION	20. LIMITATION OF ABSTRACT
17. SECURITY CLASSIFICATION 18 OF REPORT	B. SECURITY CLASSIFICATION OF THIS PAGE	OF ABSTRACT	LATION	20. LIMITA HON OF ADSTRACT
HMCLASSTETED	UNCLASSIFIED	IINCLASSIFT	ED	III.

NSN 7540-01-280-5500